
Formerly Utilized Sites Remedial Action Program (FUSRAP)

ADMINISTRATIVE RECORD

for Maywood, New Jersey



U.S. Department of Energy

ornl

ORNL/RASA-85/38

**OAK RIDGE
NATIONAL
LABORATORY**

MARTIN MARIETTA

RESULTS OF THE RADIOLOGICAL SURVEY AT
110 LAWRENCE AVENUE (LJ024), HASBROUCK HEIGHTS, NEW JERSEY

OPERATED BY
MARTIN MARIETTA ENERGY SYSTEMS, INC.
FOR THE UNITED STATES
DEPARTMENT OF ENERGY

Access to the information in this report is limited to those indicated on the distribution list and to Department of Energy and Department of Energy Contractors

HEALTH AND SAFETY RESEARCH DIVISION

Nuclear and Chemical Waste Programs
(Activity No. AH 10 05 00 0; ONLWC01)

RESULTS OF THE RADIOLOGICAL SURVEY AT
110 LAWRENCE AVENUE (LJ024), HASBROUCK HEIGHTS, NEW JERSEY

R. W. Doane

Date of Issue - December 1985

Investigation Team

B. A. Berven - RASA Program Manager
W. D. Cottrell - FUSRAP Project Director
R. W. Doane - Field Survey Supervisor

Survey Team Members

A. C. Butler
B. S. Ellis
K. P. Monar

Work performed as part of the
RADIOLOGICAL SURVEY ACTIVITIES PROGRAM

Prepared by the
OAK RIDGE NATIONAL LABORATORY
Oak Ridge, Tennessee 37831
operated by
MARTIN MARIETTA ENERGY SYSTEMS, INC.
for the
U. S. DEPARTMENT OF ENERGY
under Contract No. DE-AC05-84OR21400

CONTENTS

	<u>Page</u>
LIST OF FIGURES AND TABLES	v
ACKNOWLEDGEMENTS	vii
INTRODUCTION	1
SURVEY METHODS	1
SURVEY RESULTS	1
Systematic and Biased Soil Samples.	2
Gamma Radiation Levels.	2
SUMMARY.	2
REFERENCES	3

LIST OF FIGURES AND TABLES

<u>Figure</u>		<u>Page</u>
1	Diagram showing locations of soil samples taken at 110 Lawrence Avenue, Hasbrouck Heights, New Jersey.	4
2	Gamma radiation levels measured at 110 Lawrence Avenue, Hasbrouck Heights, New Jersey	5

<u>Table</u>		<u>Page</u>
1	A summary of applicable radiation guidelines.	6
2	Background radiation levels for the northern New Jersey area	7
3	Concentrations of radionuclides in soil at 110 Lawrence Avenue, Hasbrouck Heights, New Jersey.	8

ACKNOWLEDGEMENTS

Research for this project was sponsored by the Division of Remedial Action Projects, U.S. Department of Energy. The author wishes to acknowledge the support of J. E. Baublitz, Director, Division of Facility & Site Decommissioning Projects, E. G. DeLaney, Manager, FUSRAP/Surplus Facilities Group, and members of their staff. In addition, the author appreciates the manuscript preparation by S. E. Huckaba.

RESULTS OF THE RADIOLOGICAL SURVEY AT
110 LAWRENCE AVENUE, HASBROUCK HEIGHTS, NEW JERSEY*

INTRODUCTION

A radiological survey of 110 Lawrence Avenue, Hasbrouck Heights, New Jersey, was conducted by a survey team from Oak Ridge National Laboratory (ORNL) on April 13, 1985 at the request of the Department of Energy (DOE). This property was identified as being suspected of having contaminated material present during the mobile gamma scan of Lodi, New Jersey.¹

The radiological survey conducted on this property was for the purpose of determining whether the property had any radioactive material onsite in excess of background radiation levels, and, if so, were these radioactive materials in excess of remedial action guidelines established by DOE such that the property could be "designated" for further investigation. This report summarizes the results of the "designation" survey performed on this property.

SURVEY METHODS

The radiological survey of the property included: (1) a gamma scan of the entire property outdoors; and (2) sampling of surface (0-15 cm) soil. No indoor survey measurements were performed. These survey methods followed the plan outlined in Reference 2. A comprehensive description of the survey methods and instrumentation has been presented in another report.³

SURVEY RESULTS

Applicable federal guidelines have been summarized in Table 1. The normal background levels for the northern New Jersey area are presented in Table 2. These data are provided for comparison with the survey results presented in this section. All direct measurement results

* The survey was performed by members of the Radiological Survey Activities Group of the Health and Safety Research Division at Oak Ridge National Laboratory under DOE contract DE-AC05-84OR21400.

presented in this report are gross readings at ground surface; background radiation levels have not been subtracted. Similarly, background concentrations have not been subtracted from radionuclide concentrations measured in environmental samples.

Systematic and Biased Soil Samples

Systematic soil samples were taken from various locations on the property for radionuclide analyses. Locations of the systematic (LJ24S) samples are shown in Fig. 1, with results of laboratory analyses provided in Table 3. No biased soil samples were taken. Concentrations of uranium, radium, and thorium were within normal background levels in both systematic samples.

Gamma Radiation Levels

Results of the gamma scan of the surface of the property showed no gamma exposure rates in excess of background radiation levels. The range of exposure rates is 6-10 $\mu\text{R}/\text{h}$ over the entire property.

SUMMARY

Measurements taken at 110 Lawrence Avenue indicate that the property contains no radioactive contamination above natural background levels. High purity germanium analysis of soil samples confirms the surface gamma scan measurements that only background radiation levels exist on this property.

REFERENCES

1. R. W. Doane and B. A. Berven, "Results of the Mobile Gamma Scanning Activities in Lodi, New Jersey," Oak Ridge National Laboratory, ORNL/RASA-84/3 (October 1984).
2. W. D. Cottrell, ORNL, to A. J. Whitman, DOE/HQ, correspondence, "Radiological Survey of Private Properties in Lodi, New Jersey" (August 15, 1984).
3. Oak Ridge National Laboratory, Procedures Manual for the ORNL Remedial Action Survey and Certification Activities (RASCA) Program, ORNL/TM-8600 (October 1982).
4. U.S. Department of Energy, Radiological Survey of the Middlesex Municipal Landfill, Middlesex, New Jersey, DOE/EV-0005/20, April 1980.
5. T. E. Myrick and B. A. Berven, State Background Radiation Levels: Results of Measurements Taken During 1975-1979, Oak Ridge National Laboratory, ORNL/TM-7343 (November 1981).

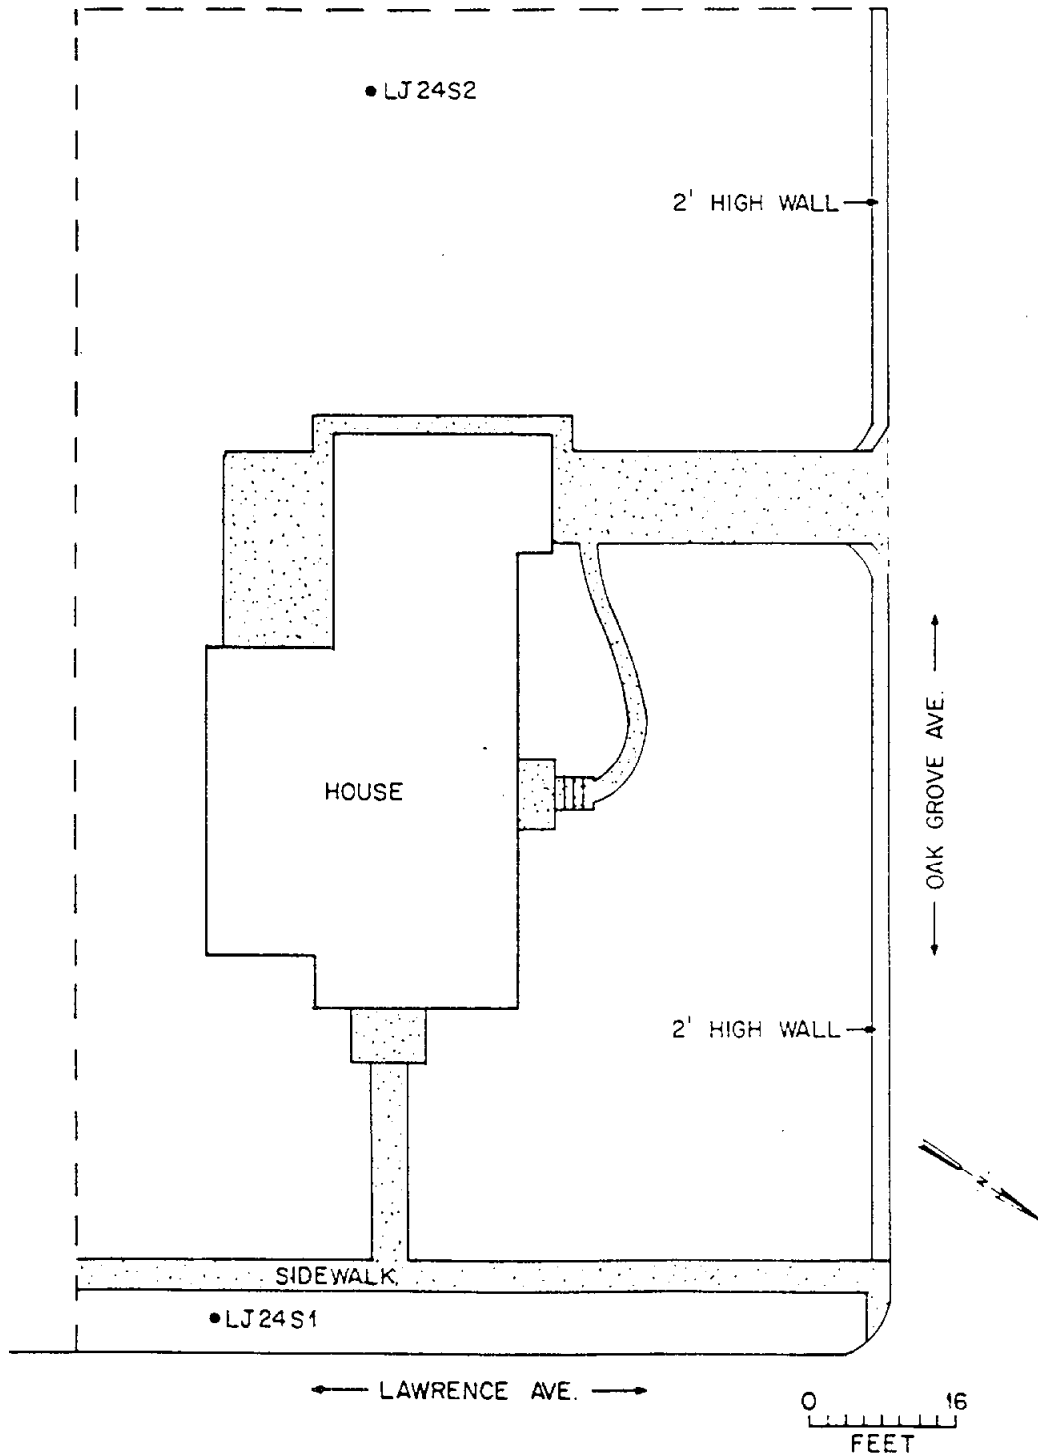


Fig. 1. Diagram showing locations of soil samples taken at 110 Lawrence Avenue, Hasbrouck Heights, New Jersey.

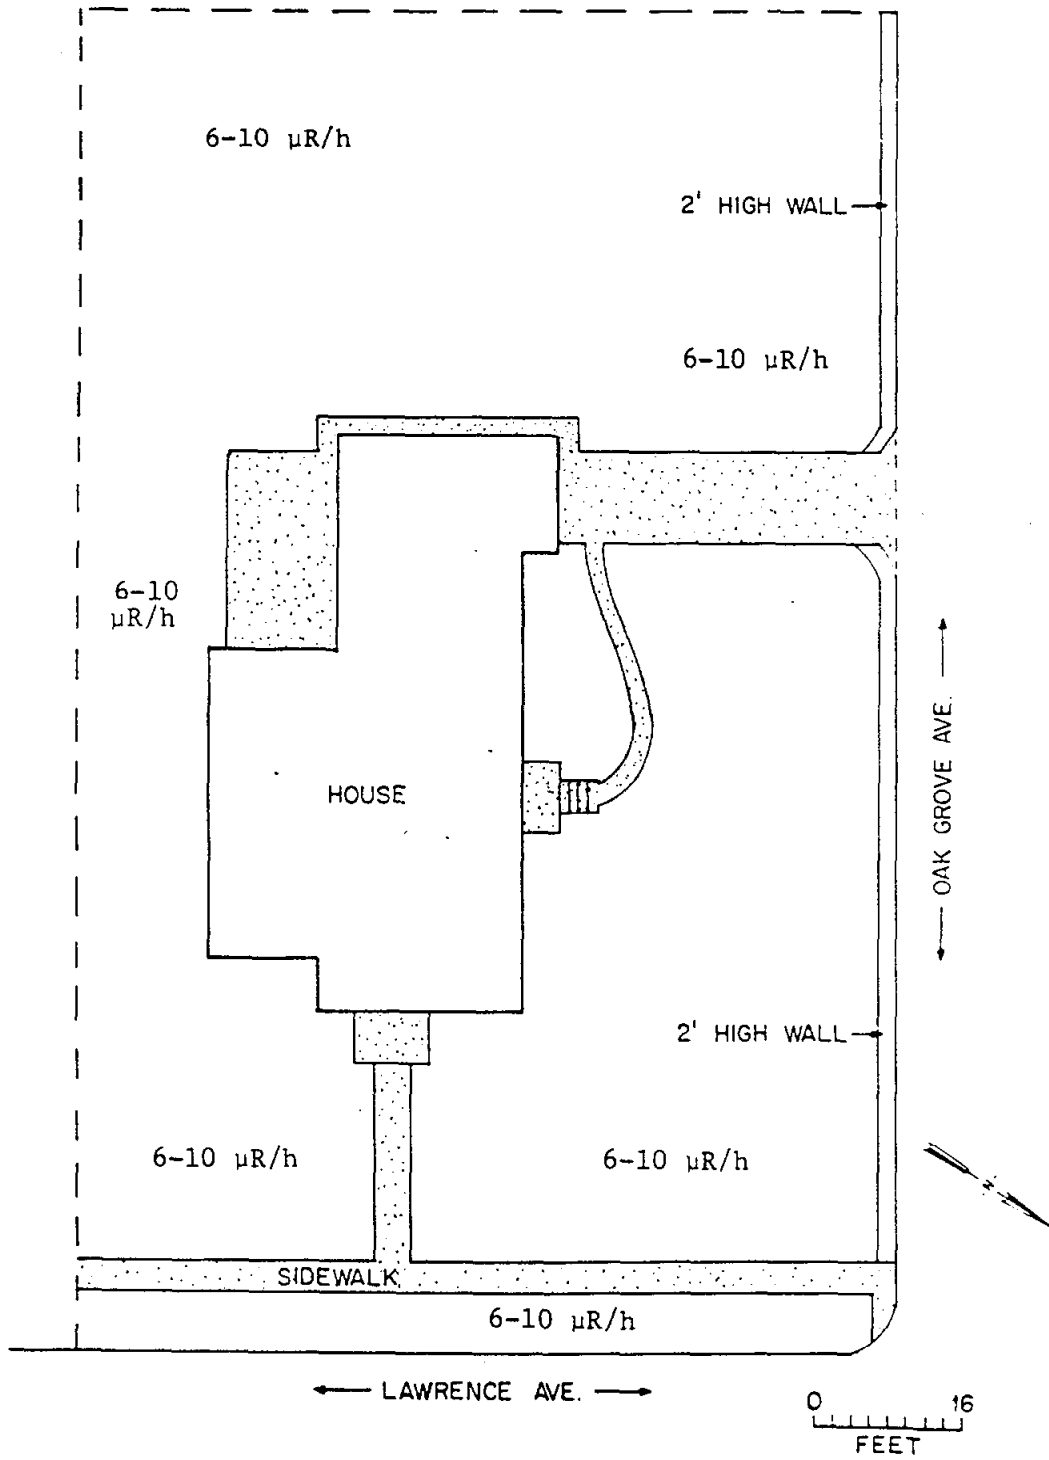


Fig. 2. Gamma radiation levels measured at 110 Lawrence Avenue, Hasbrouck Heights, New Jersey.

Table 1. A summary of applicable radiation guidelines for the FUSRAP program (July 1985).

Mode of exposure	Exposure conditions	Guideline value	Guideline source
1. Gamma radiation	Continuous exposure to individual in general population (whole body)	57 μ R/h	DOE Order 5480.1A Chapter 11 Requirements for Radiation Protection
2. Radionuclide concentrations in soil	Maximum permissible concentration of the following radionuclides in soil above background levels averaged over 100 m ² area ²²⁶ Ra ²³² Th	5 pCi/g averaged over the first 15 cm of soil below the surface; 15 pCi/g when averaged over 15-cm thick soil layers more than 15 cm below the surface and less than 1.5 m below the surface	U.S. Department of Energy Guidelines for Residual Radioactivity at Formerly Utilized Sites Remedial Action Program and Remote Surplus Facilities Management Program Sites (Revision 1, July 1985)

Table 2. Background radiation levels for the northern New Jersey area.

Type of radiation measurement or sample	Radiation level or radionuclide concentration
Gamma exposure rate at 1 m above floor or ground surface ($\mu\text{R}/\text{h}$)	8 ^a
Concentration of radionuclides in soil (pCi/g)	
²³² Th	0.9 ^b
²³⁸ U	0.9 ^b
²²⁶ Ra	0.9 ^b

^aReference 4.^bReference 5.

Table 3. Concentrations of radionuclides in soil at 110 Lawrence Avenue, Hasbrouck Heights, New Jersey.

Sample ^a	Depth (cm)	Radionuclide concentration (pCi/g)		
		²²⁶ Ra ^b	²³² Th ^b	²³⁸ U ^c
<u>Systematic samples</u>				
LJ24S1	0 - 15	0.88 ± 0.08	0.87 ± 0.3	0.99
LJ24S2	0 - 15	1.3 ± 0.09	0.95 ± 0.4	1.3

^aLocations of soil samples are shown on Fig. 1.

^bIndicated counting error is at the 95% confidence level ($\pm 2 \sigma$).

^cTotal analytical error of measurement results is less than $\pm 5\%$ (95% confidence level).

INTERNAL DISTRIBUTION

- | | | | |
|-------|----------------|-----|--------------------------|
| 1-3. | B. A. Berven | 12. | P. T. Owen |
| 4. | R. O. Chester | 13. | T. H. Row |
| 5. | W. D. Cottrell | 14. | IRgA Publications Office |
| 6-10. | R. W. Doane | 15. | Laboratory Records - RC |
| 11. | S. V. Kaye | | |

EXTERNAL DISTRIBUTION

16. J. D. Berger, Oak Ridge Associated Universities, P. O. Box 117, Oak Ridge, TN 37831
- 17-26. Edward DeLaney, U.S. Department of Energy, 19901 Germantown Road, Germantown, MD 20874
- 27-29. E. L. Keller, U.S. Department of Energy, P. O. Box E, Oak Ridge, TN 37831
- 30-32. J. F. Nemec, Bechtel National, Inc., 800 Oak Ridge Turnpike, Oak Ridge, TN 37831
33. Office of Assistant Manager, Energy Research and Development, Oak Ridge Operations Office, Oak Ridge, TN 37831
- 34-35. Office of Scientific and Technical Information, DOE, Oak Ridge, TN 37831